

Missoula County Control Point Datasheet

Monument Description: 3-1/4" Aluminum Cap 9330LS

Project Name: All

Station Description: 1/4 Corner


Date Visited: Sept. 1, 2010

Monument Stability: C+ GPS Visibility: C+

Observer: SEN - CLG

Quad. Name: Blue Point

T. 13 N. R. 18 W.

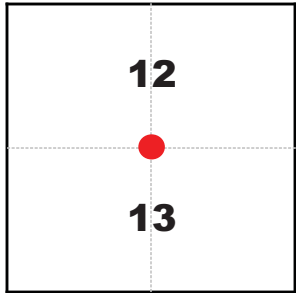

NAD 83 (2007) Lat/Long Position

46°53'32.559"N

113°49'04.006"W

NAVD 88 Elevation: 3296.4 sft.

Notes:

Photo of Monument



Photo Looking North



Photo Looking South



Point # 5885

To Reach: 2wd access to within 200 feet of the monument.



Map of Area

INSTRUCTIONS
 Q-CO-STD/152

1. Original and/or subsequent record used to evaluate the corner position.
2. Description of evidence found, note discrepancies in the record, state method of establishing lost or obliterated corners.
3. Description of monument and accessories set to perpetuate the corner position.
4. Sketch of corner, show all pertinent data which can be shown in a sketch example, corner marking, topography ties, position of monument.
5. Certification must be signed and sealed by Land Surveyor registered in the State of Montana.
6. Fill in Cross Index & Section Diagram at bottom of sheet.

CERTIFIED CORNER RECORDATION

Corner 1/4 Cnr. For Sections 12 & 13 T. 13 N. R. 18 W. P.M.M. Missoula County

1979 Record (Ainsworth 2923S):
 Found 1" pipe (bent to south). Corner is on the bank of the Blackfoot River; probably under during high water.
 Original BT stump bears S84°E, 23.1 feet.
 12" pine bears S 62°E, 25.8 feet.

2007 Found:
 Found 1 1/4" pipe lying loose. Found the following bearing trees:
 Stump remains w/ existing and BT tag (1978) nearby; (GLO Record- 15" fir bears S84°E, 23.1 feet).
 14" pine bears S 62°E, 25.8 feet, w/ BT tags on tree.

2007 Perpetuation:
 At the corner position established via distance-distance intersect from the found live BT and the original BT remains, a set of 5/8" x 30" rebar capped with a 3 1/4" aluminum cap marked as noted below. Established the following new reference:
 A 23in. fir bears N50°E, 50.8 ft.

CERTIFICATION
 I, Joe Bauch, certify the information shown herein is true and correct.
Joe Bauch
 Signature Ground Party Chief

I, Ken E. Jenkins, certify that this Corner Record correctly represents the position of the monument as shown on the plat and in the direction in compliance with the Montana Recordation Act (70-22-01, et seq., M.C.A.).
Ken E. Jenkins
 Signature of Surveyor & Professional Seal

Date: 10/20/07 Reg. No. 9330 L.S.
 Employer: Montana NorthWest Company
 Project No. 1496-06

SKETCH OF CORNER

| | | | | |
|--|--|--|--|--|
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |

Sec. 12

Cross Index No. J-23 T. 13 N. R. 18 W. PMM - Corner this sheet

Corner Recordation Form or Other Supporting Document

Point # 5885