INSTRUCTIONS

- Original and/or subsequent record used to evaluate the corner position.
 Description of evidence found, note discrepancies in the record, state method of establishing lost or obliterated
- 3. Description of monument and accessories set to perpetuate the corner position.
- 4. Sketch of corner, show all pertinent data which can best be shown in a sketch example, corner marking, topography ties, position of accessories, etc.
- Certification must be signed and sealed by Land Surveyor registered in the State of Montana.
 Fill in Cross Index & Section Diagram at bottom of sheet.

CERTIFIED CORNER RECORDATION

P.M.M. <u>Deer Lodge County</u> 1/4 Corner Section<u>8</u> T. <u>5 N.</u> R. <u>13 W.</u>

ORIGINAL RECORD: (G.L.O.) Not recovered.

SUBSEQUENT RECORD: (1967 B.L.M.)

The 1/4 sec. cor. of sec. 8, only, monumented with a limestone, 14 x 12 x 5 ins., firmly set, mkd. 1/4 on the N. face,

and witnessed by the remains of one original bearing tree.

At the corner point

Set an iron post, 30 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd. [as shown]

The original bearing tree, a pine snag, 8 ins. diam., bears S. 16 \(\frac{3}{4} \) E., 10 lks. dist., mkd. 1/4 S17 BT.

(Record: S. $37\frac{3}{4}^{\circ}$ W., 26 lks.)

The new bearing trees:

A pine, 6 ins. diam., bears N. 48° E., 29 lks. dist., mkd. 1/4 BT. A fir, 6 ins. diam., bears N. 2° W., 66 lks. dist., mkd. X BT.

Bury the original stone alongside and raise a collar of stone, 3 ft. diam., around the iron post.

EVIDENCE FOUND: Found 31/4" Brass Cap, 0.5' above ground in mound of stone, from which:

A lodgepole pine, 10 ins. diam., scribing visible, bears N45°E, 29 lks. dist.

PERPETUATION: Left monument as found.


Date of Survey: October, 2009.



NAD 83 coordinates for this corner:

Latitude = 46°11'37.86206"N Longitude = 113°15'15.12352"W

NOTE: These coordinates are to be used as a search tool only.

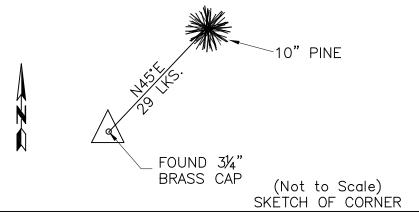

CERTIFICATION

Steve Cummings herein is true and correct

Signature Ground Party Chief


Kurt A. Luebke

certify that this Corner Record correctly represents work performed by me or under my direction in compliance with the "Corner Recordation Act" (70-22-101, et seq., M.C.A.)

Signature of Surveyor & Seal

10-27-2009 Reg. No. 13237 S

DJ&A P. C. Employer:

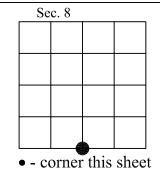

- GCDB\5688 - GCDB\dwg\CORNER RECORDATION dwg