## INSTRUCTIONS

- 1. Original and/or subsequent record used to evaluate the corner position.
- 2. Description of evidence found, note discrepancies in the record, state method of establishing lost or obliterated
- Description of monument and accessories set to perpetuate the corner position.
- 4. Sketch of corner, show all pertinent data which can best be shown in a sketch example, corner marking, 5. Certification must be signed and sealed by Land Surveyor registered in the State of Montana.

  6. Fill in Cross Index & Section Diagram at bottom of sheet.

## CERTIFIED CORNER RECORDATION

of Secs. 21 and 22 only T. \_\_\_\_\_\_R. \_\_\_\_\_P.M.M. Lincoln Corner County 1893 G.L.O. record by Danial P. Mumbrue: Set a wood post for corner of secs. 15, 16, 21 & 22, marked four bearing trees.

1901 G.L.O. retracement record by Abram E. Jaqueth: Effaces marks on wood post and bearing trees to refer to secs. 21 and 22 only.

1962 B.L.M. remonumentation record by Gerald F. Pittman et al: "The cor. of secs. 21 and 22, as determined from the remains of the original bearing trees. At corner point; set an iron post, 30 ins. long, 2 1/2 ins. diam., 26 ins. in the ground, with brass cap mkd.



From which:

The remains of the original bearing trees:

A stump, 18 ins. diam., bears N16 3/4 E, 70 lks. dist., visible marks T31N R31W S15 (record). A decayed stump, bears  $S12^{\circ}W$ , 29 lks. dist., no visible marks (Record:  $S17^{\circ}W$ , 29 lks.).

The new bearing trees:

A pine, 10 ins. diam., bears S78°E., 24 lks. dist., mkd. T31N R31W S22 BT. A pine, 6 ins. diam., bears  $860^{\circ}$ W, 47 lks. dist., mkd. X S21 BT S20 BT.

Raise a flat mound of stone, 3 ft. dlam., around the iron post.

II. Found a 2 1/2 ins. diam. iron pipe, 3 ins. out of mound of stone 3 ft.diam. by 2 ft. high with a 3 1/4 ins. diam. B.L.M. brass cap, marked as shown above, from which

A fallen pine, 11 ins. diam., bears S80  $^{\circ}$ E., 15.0 ft. (23 lks. dist.), mkd. T31N R31W S22 BT.


A pine stump, 9 ins. diam., bears 860 W, 31.0 ft. (47 lks.) dist., mkd. BT. A decayed stump, bears 817 E, 46.0 ft. (70 lks.) dist., no visible marks.

III. Established two new bearing trees:

A larch, 9 ins. diam., bears  $883^{\circ}E$ , 19.7 ft. dist., mkd. T31N R31W S22 BT. A larch, 7 ins. diam., bears  $835^{\circ}W$ , 68.8 ft. dist., mkd. T31N R31W S21 BT.

Painted red bands around the bearing trees and attached Land Survey Monument and Bearing Tree signs. Set a 6 ft. galvanized steel guard post with Land Survey Marker & Property Boundary decals, West, 3 ft.

Magnetic Declination: 20° East

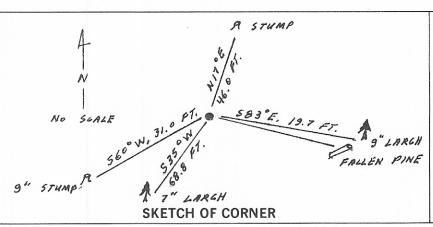

LONTAN CERTIFICATION PLARSON I. Raymond A. Pederschiff the information shown herein is in a name of the certify the information shown herein is in a name of the certify the information shown herein is in a name of the certify the certify the certific and the certification and the certific Signature Ground Party Charles certify that this Corner Record correctly represents work performed by me or under my direction in compliance with the Recordation Act' (70-22-101, et seq., M.C.A.) 11/23/92 Reg. No. 9008LS Employer: U.S. FOREST SERVICE

PMM

Office of Clerk and Recorder, County of . This "corner record" was filed for record on \_ was noted on the cross-index plat and is assigned page No. book No. -

Sec.

· corner this sheet